

Manhole Inspection Summary

Manhole # S39S__020MH

Printed On: 3/13/2009

Page 1 of 3

Inspection ☐ Is Incomplete Rating: **3) Fair**

Record Plat: **39S** Node: **020** Status: **Found**

Insp Date: **10/17/08 11:20 AM**

Incomplete Comments

Crew: **DD**
Inspector: **jjoirer**
Firm: **ATS**

Location Address: **key highway**

Cross Street: **jackson st**

Manhole Type: **Inline** Location: **Light Highway**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

Cover Shape: **Circular** Diameter: **32** (in.) Length: **0** (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☒ Vented ☐ Water Tight ☐ Water Tight Insert

Frame Offset: **3.5** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

Chimney / Frame Adjustment ☐ Exists Material: ☐ Parged Height: **0** (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Corbel Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Barrel Material: **Brick** ☐ Parged

Shape: **D-Shape** Diameter: **48** (in.) Length: **42** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

Bench ☒ Exists Material: **Brick** ☐ Parged

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☒ Debris

Channel Material: **Brick** ☐ Parged

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth: **0**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

Steps Count: **8** Missing: **1** ☒ Corroded

Surcharge ☐ Evidence Of Surcharge Depth: **0** (ft.) ☐ Active Surcharge Present

Manhole Inspection Summary

Manhole # S39S__020MH

Printed On: 3/13/2009

Page 2 of 3

Location View



Top View



Defect 3




bench debris

Defect 2



cor. steps/missing 1st step

Defect 1

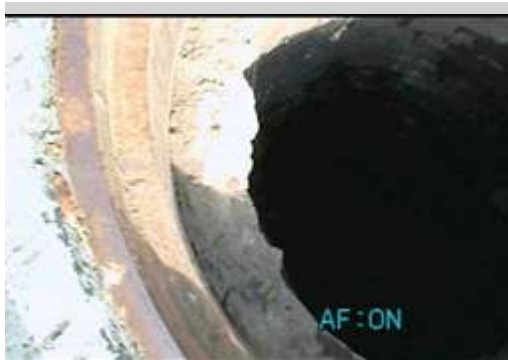

offset

Manhole Inspection Summary

Manhole # S39S__020MH

Printed On: 3/13/2009

Page 3 of 3

10 in. Circular Gravity Sewer
Pipe Out @ 12 O'Clock

12 O'Clock Outflow



pipe under ledge cant get better pic

Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.50** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

10 in. Circular Gravity Sewer
Pipe In @ 6 O'Clock

6 O'Clock Inflow



couldnt get better pic because of ledge over pipe

Pipe Height: 0 (in.) Direct

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **12.25** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: 0 (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection